
# Pascal 90°index table

High-speed 90° indexing with high accuracy

Roller gear cam drive & Hirth coupling 90°index table



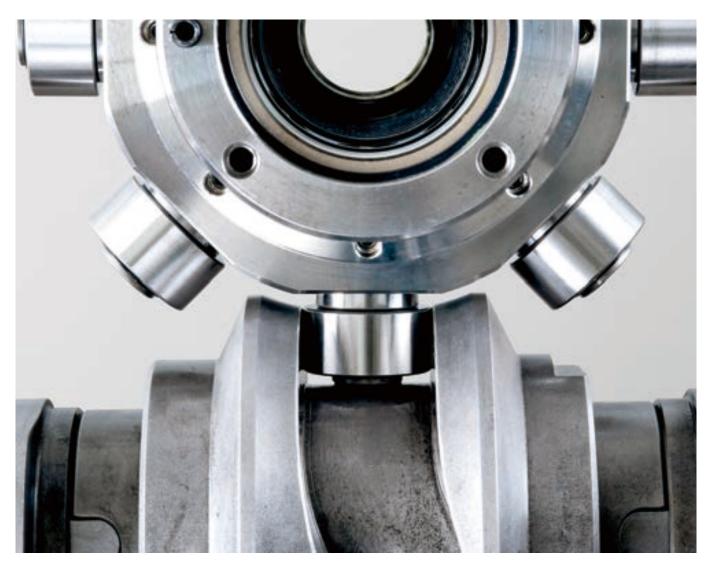

model MDX


# Pascal 90°index table


Roller gear cam drive & Hirth coupling 90°index table

90°indexing 0.5 sec.

Index accuracy ±5 arc sec.

Quick, Accurate, durable, 1 million rotation No adjustment.

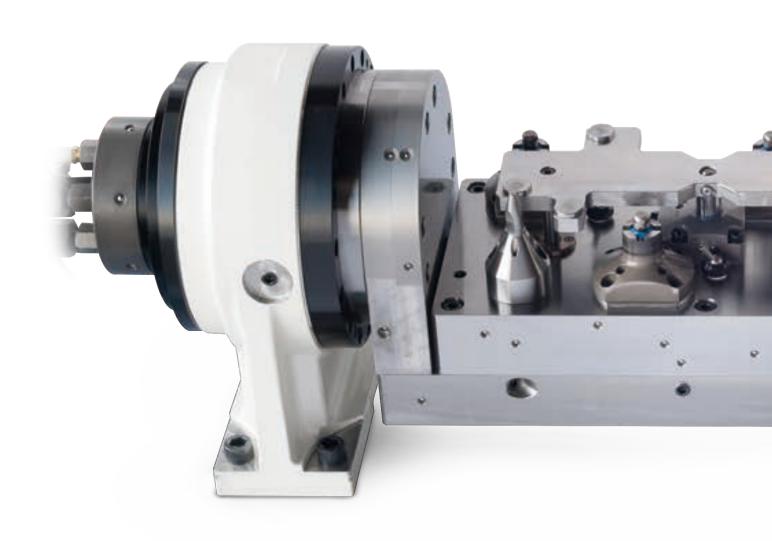

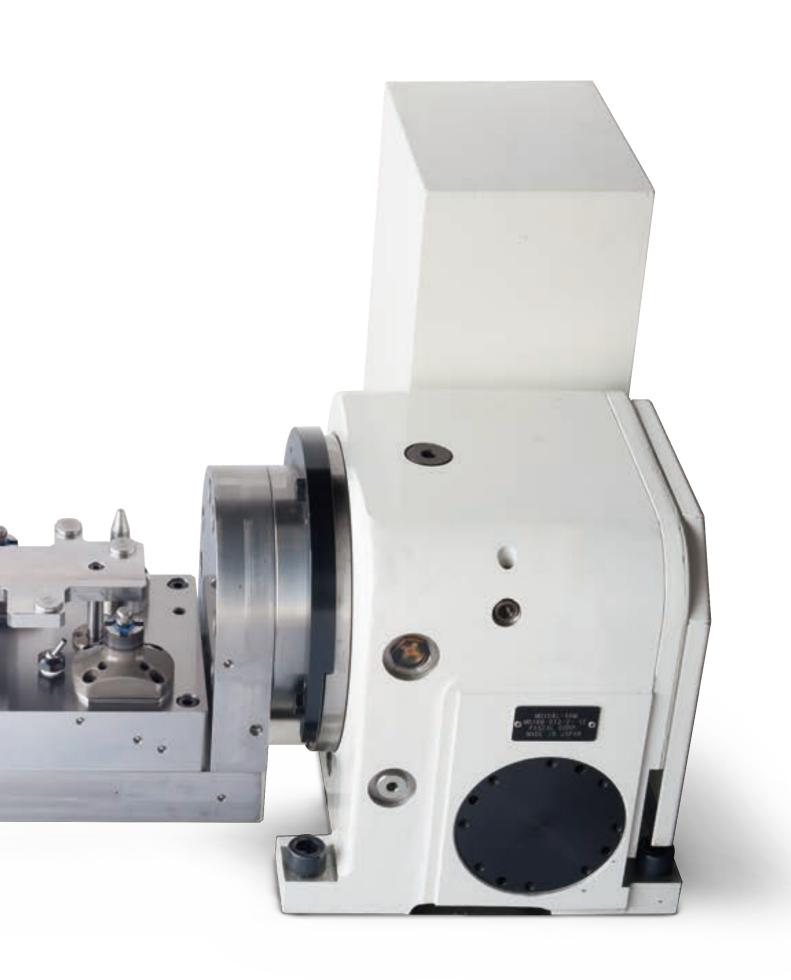

90°index table model MDX




Support table model MDS



#### Optimum cam curve makes the speed and durability

 Roller gear cam drive provides smooth acceleration and deceleration movement according to the machine characteristic by adapting a cam curve.



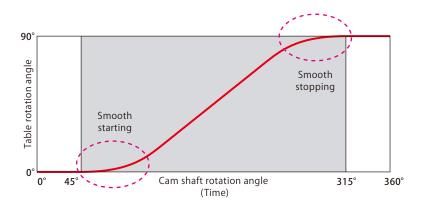

#### In case of worm gear…

In case of worm gear drive, the worm wheel rotation angle is represented by a rectilinear velocity-diagram as shown in the sketh below, also worm gear drive needs time for braking. To secure smooth acceleration and deceleration (start/stop), an expensive servo motor (NC additional axis control) must be required.




- Time


  In the contact of the contact
- There is the necessity of periodical backlash adjustment due to abrasive wear on worm gear.
- In case big rotational load exerted on the wormshaft, its support bearing requires a maintenace which has an effect on the durability of the mechanism.

#### 90°indexing 0.5 sec.

# Roller gear cam drive with an excellent indexing motion characteristic.

• Excellent movement characteristic by transmitting the roller gear cam rotation enables high speed indexing (90°- 0.5 sec.). Rolling transmission mechanism allows abrasive wear to be minimized also it can eliminate excessive load onto drive mechanism, which ensures quick start/stop operation even with an inverter control made by a general purpose motor allowing money-saving and high maintainability.

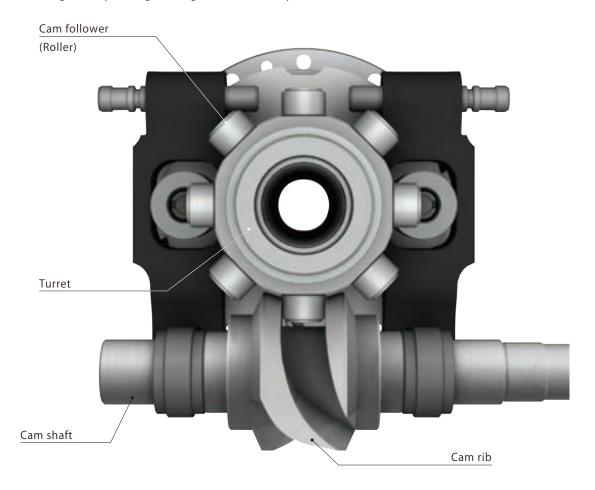


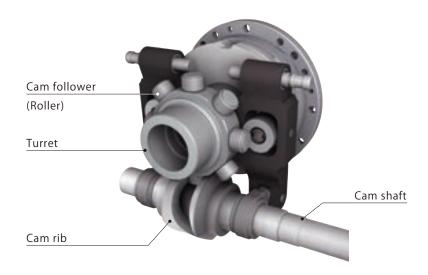


#### Index accuracy $\pm 5$ arc sec.


# Locking with 3-piece hirth coupling.

- ullet Special three-piece hirth coupling is incorporated in the index lock system. This full mechanical lock system with a taper coupling maintains high indexing accuracy within  $\pm 5^{\circ}$  for long period, which ensures high speed , heavy duty and high accuracy machining consistently.
- The tapered engaging position of the hirth coupling absorbs the misalignment caused by the backlash moderately provided for the roller gear cam, and mechanically indexes/holds the table at the desired angle with accuracy. A workpiece is held securely at a desired angle against the load torque and vibration during machining/cutting.
- Locking by using the hirth coupling synchronizes the movement of roller gear cam and there is no time lag between locking and unlocking action thereby enabling high speed indexing.

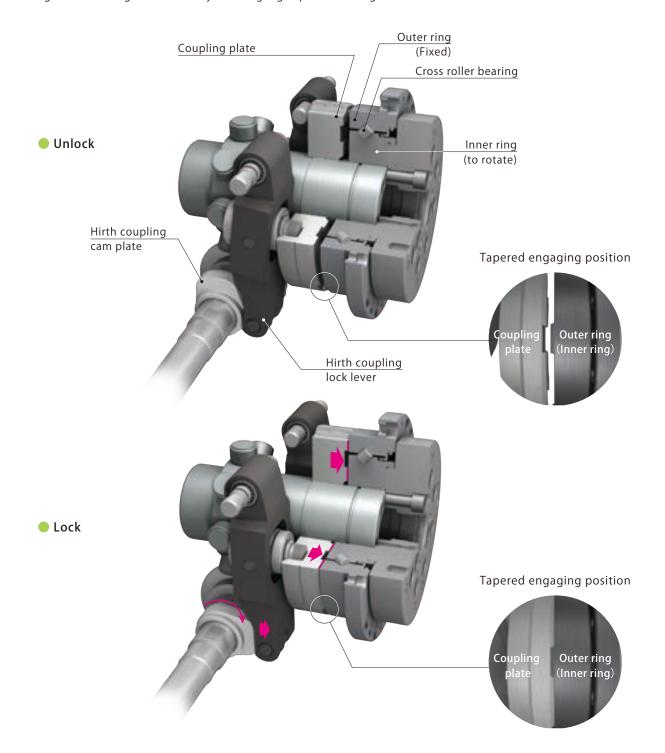

#### 90° index table

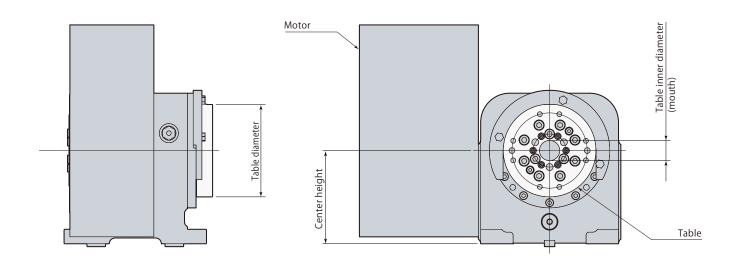


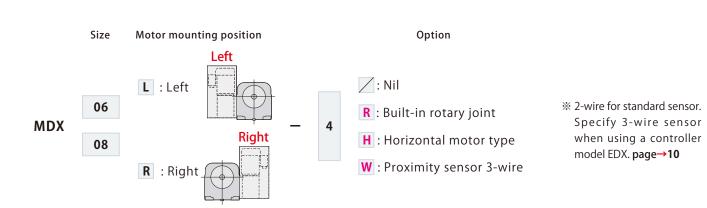

| Model                                    |          | MDX06            | MDX08     |  |
|--|----------|------------------|-----------|--|
| Table diameter                           | mm       | ø160             | ø200      |  |
| Center height                            | mm       | 161              | 185       |  |
| Table inner diameter (mouth)             | mm       | ø35              | ø48       |  |
| Mass                                     | kg       | 65               | 140       |  |
| Index accuracy                           | arc sec. | ±5               |           |  |
| Repeatability                            | arc sec. | 5                |           |  |
| Number of index                          |          | 90° - 4 position |           |  |
| 90°index time (At motor speed1800rpm)    | sec.     | 0.5              |           |  |
| Allowable payload (With support table)   | kg       | 80 (160)         | 100 (200) |  |
| Allowable workpiece inertia moment *1    | kg·m²    | 0.91             | 2.02      |  |
| Allowable load (When locked) *2          | kN       | 6                | 10        |  |
| Allowable loaded torque (When locked) *2 | N∙m      | 742              | 1032      |  |
| Allowable loaded moment (When locked) *2 | N∙m      | 280              | 357       |  |

- %1: It varies depending on the condition of usage. Refer to page  $\rightarrow$  11
- ※2: The figure indicates the limiting value when independently applied.
- Refer to page → 9 for the details of rotary joint type.

#### Support table

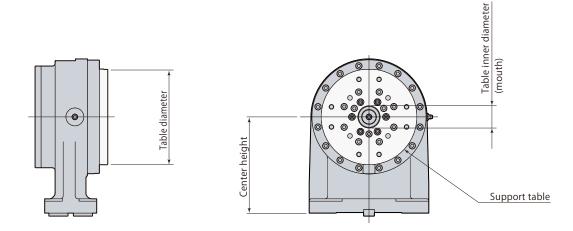

Thin and lightweight support table, which is feasible to have a rotary joint built-in, can optimize hydraulic or air jig pairing up with the rotary joint in MDX.



| Model                        |    | MDS06 | MDS08 |
|------------------------------|----|-------|-------|
| Table diameter               | mm | ø160  | ø200  |
| Center height                | mm | 161   | 185   |
| Table inner diameter (mouth) | mm | ø35   | ø48   |
| Mass (Without rotary joint)  | kg | 17    | 40    |
| Mass (With rotary joint)     | kg | 23    | 51    |

lacktriangle Refer to page ightarrow 9 for the details of rotary joint type.




#### 8ports 7 MPa

#### **Built-in rotary joint**

Built-in rotary joint type MDX is available as option.

It takes up minimum space on machine table also can maximize the cutting stroke of the machine.

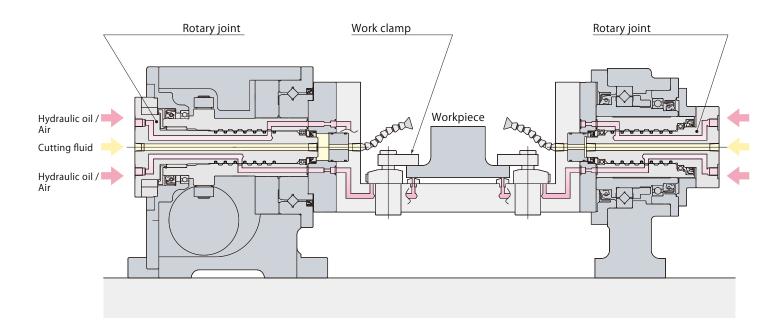




| Model                       |     | MDX06-4R/MDS06-R                          | MDX08-R/MDS08-R |
|-----------------------------|-----|---|-----------------|
| Hydraulic and air circuit   |     | G1/8×6 ports                              | G1/8×8 ports    |
| Working fluid               |     | General mineral based hydraulic oil / Air |                 |
| Max working pressure        | MPa | 7.0                                       |                 |
| Cutting fluid circuit       |     | Rc1/8×1port                               | Rc1/4×1port     |
| Max cutting fluidt pressure | MPa | 0.3                                       |                 |

- When applying hydraulic oil to rotary joint, oil film leakage to adjacent circuits is inevitable. When the oil and air circuits are being allocated in one rotary joint, be sure to allocate a circuit between them as a drain circuit. (If the air circuit can tolerate the oil leakage, drain circuit is not mandatory.
- Filtered cutting fluid should be supplied to the cutting fluid port.

#### Controller

The panel is a one axis controller because it controls MDX by means of M-code sent from the machining center control. It has indexing action complete by M-command alone.

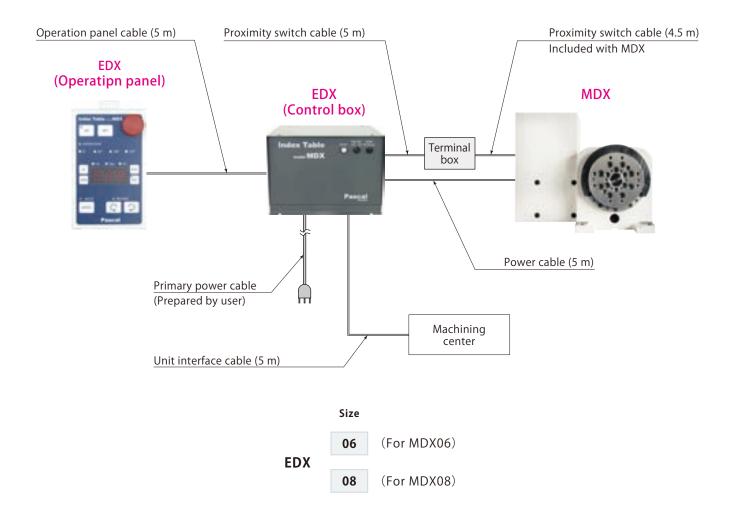



| Model                       |            | EDX06  | EDX08 |
|-----------------------------|------------|--|-------|
| Number of axis to control   |            | 1-axis control   |       |
| Power source                |            | 3-phase AC200V/220V±10% 50/60Hz  |       |
| Power source capacity       | VA         | 700  | 1200  |
| Signal interface            |            | Serial signal: For operation panel (RS422)<br>Parallel signal: For interlock |       |
| Operating temperature range | °C         | 0~40   |       |
| Storage temperature         | $^{\circ}$ | -10 ∼ 60   |       |
| Mass                        | kg         | 20 (Operating panel + Control box)   |       |

#### Moment of Inertia for allowable workpiece

The weight of workpiece that can be rotated on the table varies in accordance with its shape and the center of gravity.

In case that the workpiece is odd shaped and unbalance torque may exert, MDX should be operated in usable range in the graph shown below.

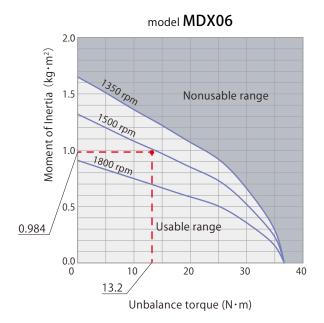

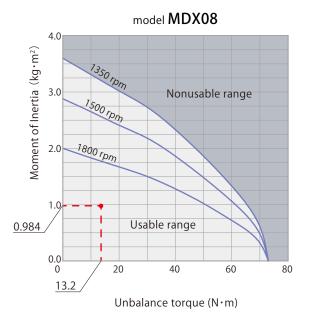

#### Example

Jig and workpiece total moment of inertia at 0.984 kg  $\cdot$  m $^2$  / total unbalance torque 13.2 N $\cdot$  m

MDX06: Motor speed 1500 rpm (90°index 0.6 sec.)


MDX08: Motor speed 1800 rpm (90°index 0.5 sec.)

#### Calculatoin example for Moment of Inertia/unbalance torque

Moment of Inertia and unbalance torque must be calculated first to clarify inertial moment for allowable

In addition, it varies not only the weight and eccentricity of workpiece but also the shape.

Example Calculate I (moment of inertia) and T (unbalance torque) of the following cylindrical and squared pole workpiece.

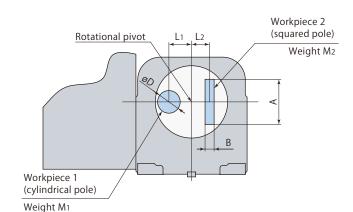

Workpiece 1 (cylindrical pole) Workpiece 2 (squared pole)

Weight M<sub>1</sub> : 60 kg Weight M<sub>2</sub> : 55 kg Eccentricity L<sub>1</sub>: 0.06 m Eccentricity L<sub>2</sub>: 0.09 m Diameter D : 0.12 m Height A : 0.21 m Wide B : 0.05 m

 Eccentricity represents the distance from the center of rotation to the center of gravity of workpiece.

● STEP1: Calculate moment of inertia I around the center of gravity.

①Workpiece 1 (cylindrical pole) 
$$I_{1A} = \frac{1}{8} \times M_1 \times D^2 = \frac{1}{8} \times 60 \times 0.12^2 = 0.108 \text{ kg} \cdot \text{m}^2$$

$$=\frac{1}{8} \times 60 \times 0.12^2 = 0.108 \text{ kg} \cdot \text{m}^2$$

②Workpiece 2 (squared pole) 
$$I_{2A} = \frac{1}{12} \times M_2 \times (A^2 + B^2) = \frac{1}{12} \times 55 \times (0.21^2 + 0.05^2) = 0.214 \text{ kg·m}^2$$

• STEP2: Calculate moment of inertia I around the rotational pivot.

①Workpiece 1 (cylindrical pole) 
$$I_1 = I_{1A} + M_1 \times L_1^2$$

$$= 0.108 + 60 \times 0.06^2 = 0.324 \text{ kg·m}^2$$

②Workpiece 2 (squared pole) 
$$I_2 = I_{2A} + M_2 \times L_2^2 = 0.214 + 55 \times 0.09^2 = 0.660 \text{ kg} \cdot \text{m}^2$$

$$I_2 = I_{2A} + M_2 \times L_2^2$$

$$= 0.214 + 55 \times 0.09^{2}$$

$$= 0.660 \text{ kg} \cdot \text{m}^2$$

STEP3: Calculate unbalance torque T

①Workpiece 1 (cylindrical pole) 
$$T_1 = 9.8 \times M_1 \times L_1$$

$$= 9.8 \times M_1 \times L_1 = 9.83$$

$$= 9.8 \times 60 \times 0.06 = 35.3 \text{ N} \cdot \text{m}$$

②Workpiece 2 (squared pole) 
$$T_2 = 9.8 \times M_2 \times L_2 = 9.8 \times 55 \times 0.09$$

$$T_2 = 9.8 \times M_2 \times L$$

$$= 9.8 \times 55 \times 0.09$$

■ STEP4: Calculate total inertia moment I and unbalance torque T

$$I = I_1 + I_2$$

$$= 0.324 + 0.660$$

$$= 0.984 \text{ kg} \cdot \text{m}^2$$


$$T = T_2 - T_1$$

$$= 48.5 - 35.3$$


$$= 13.2 \text{ N} \cdot \text{m}$$


\*Moment of Inertia will not be offset.


Left: MDX06L-4R Right: MDX06R-4R

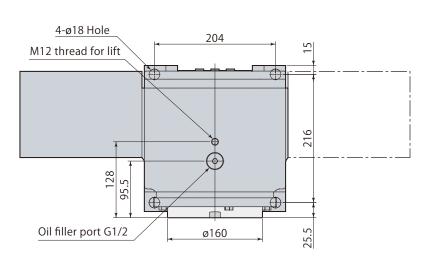


#### Detail R

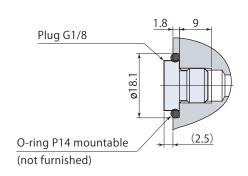

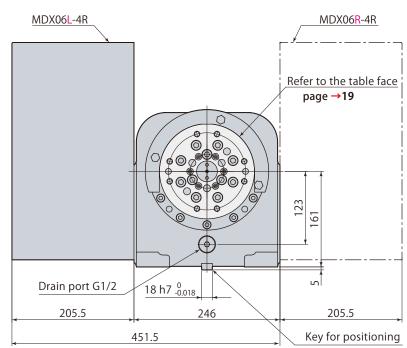


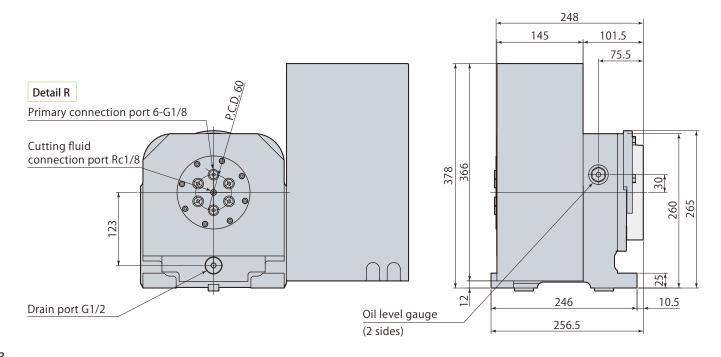


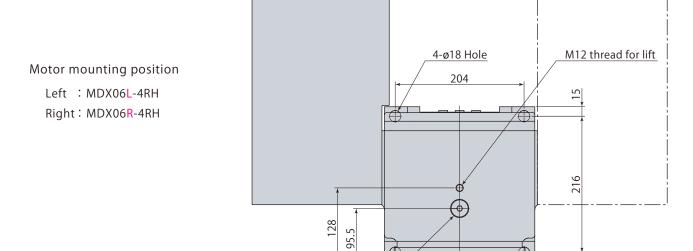

Oil filler port G1/2

Detail R

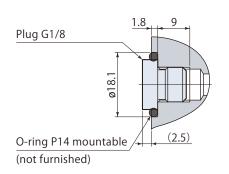


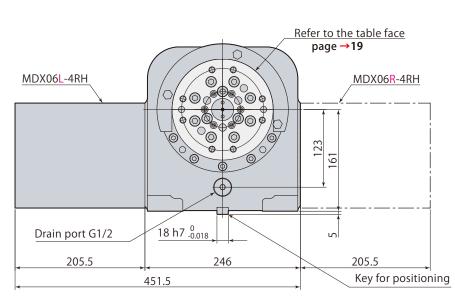


ø160


**D**-


25.5

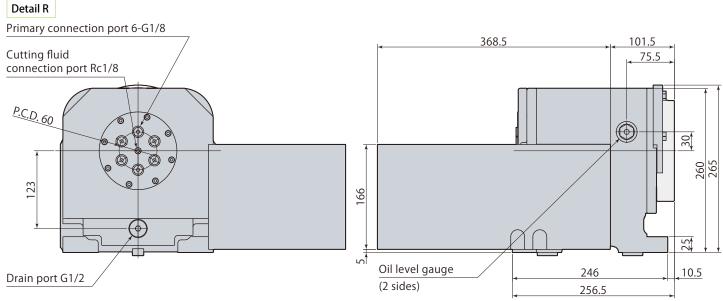


Left: MDX06L-4 Right: MDX06R-4

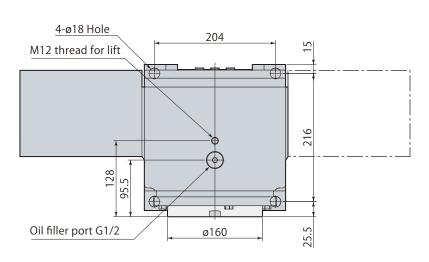


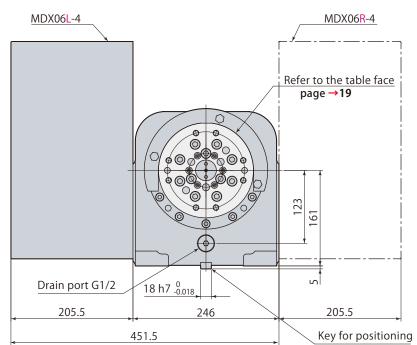


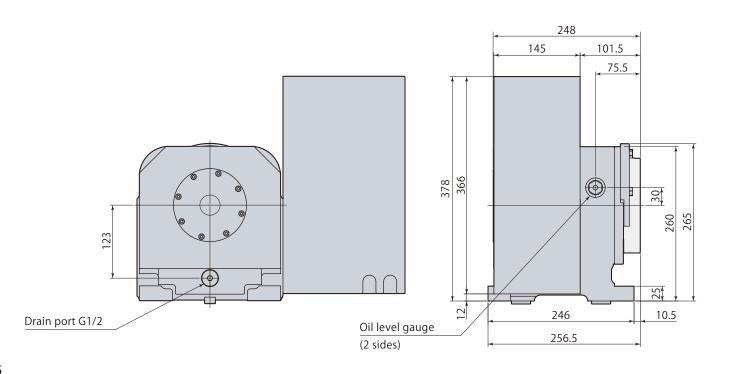



Left: MDX06L-4H Right: MDX06R-4H

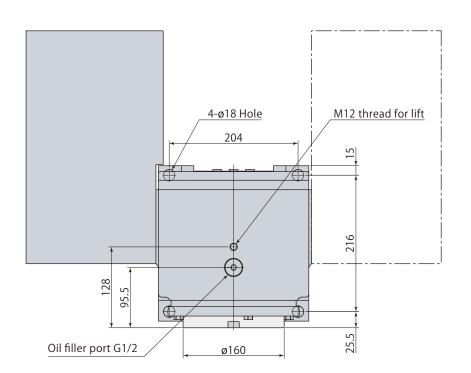


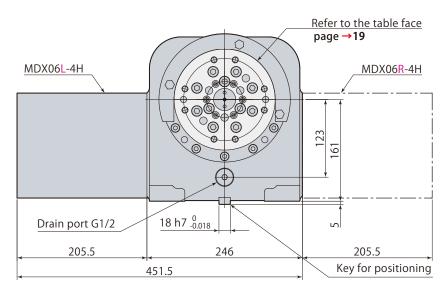


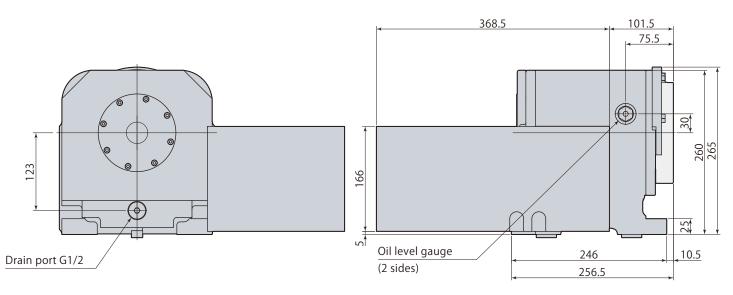


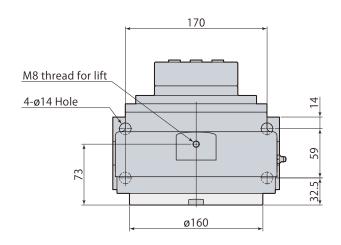


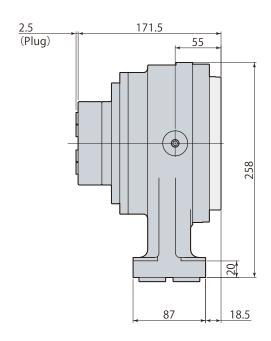


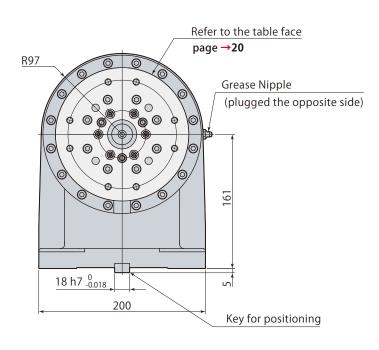


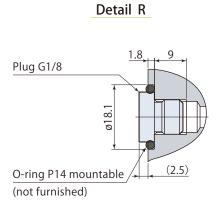


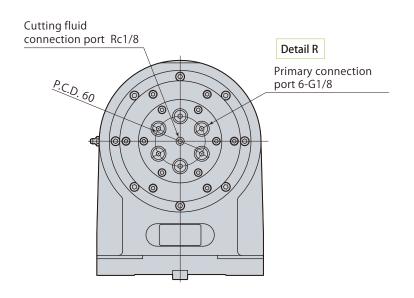

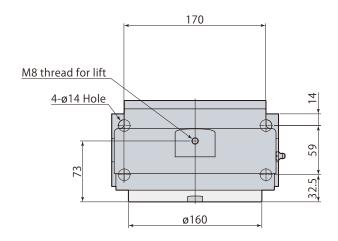

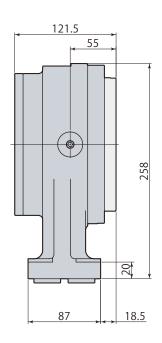


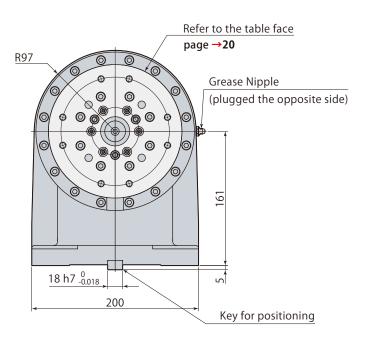


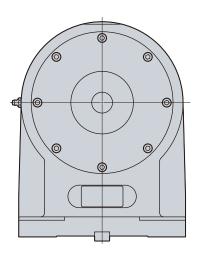


#### 90° Index table face

#### MDX06 (common)

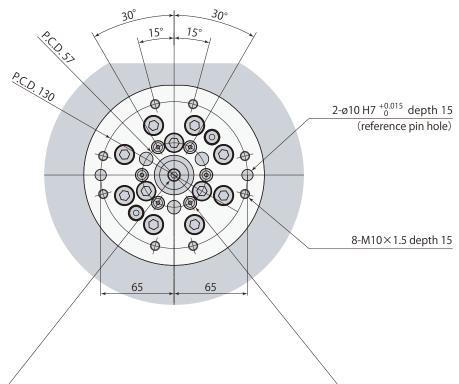

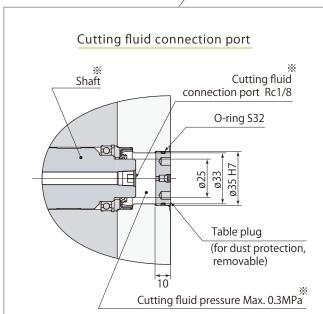


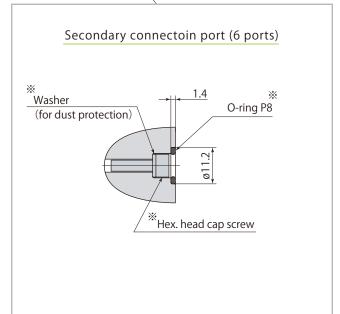



※: Only built-in rotary joint

#### Support table face


MDS06 (common)

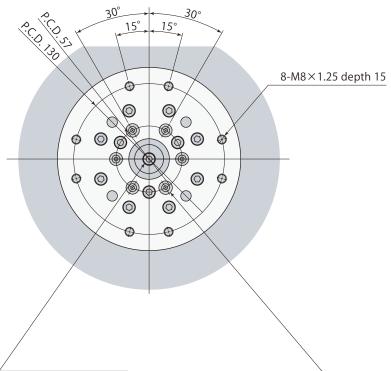

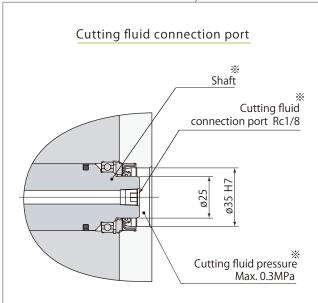


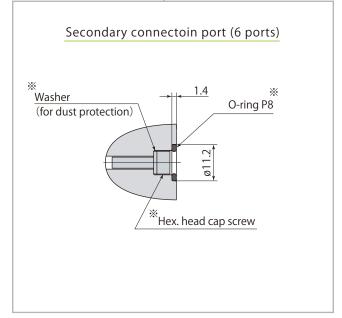


※: Only built-in rotary joint

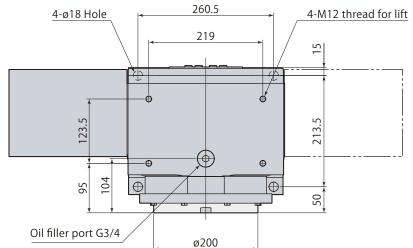


Left: MDX08L-4R Right: MDX08R-4R

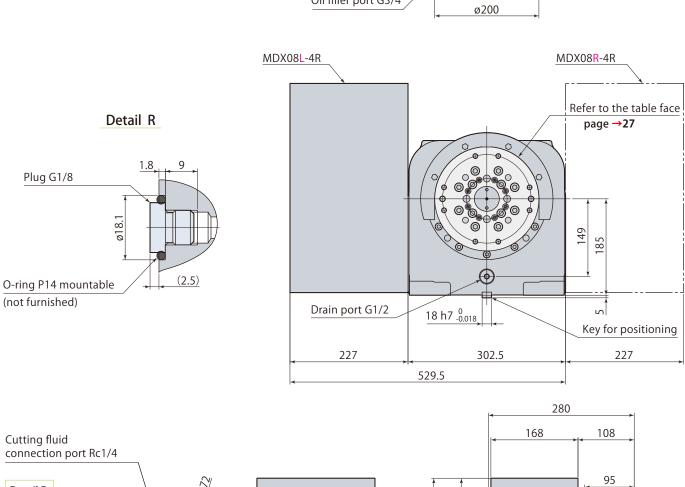


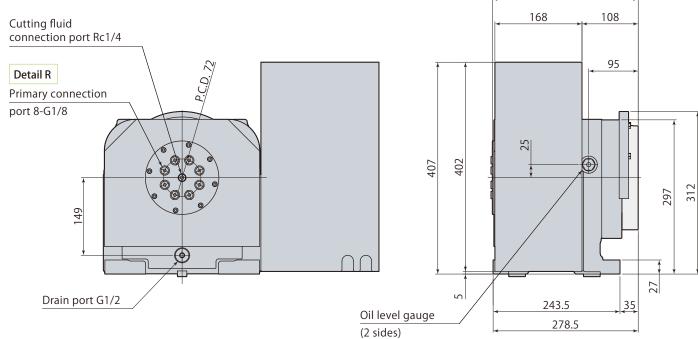




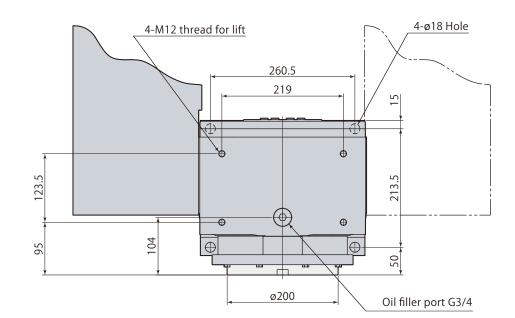



Left: MDX08L-4RH Right: MDX08R-4RH

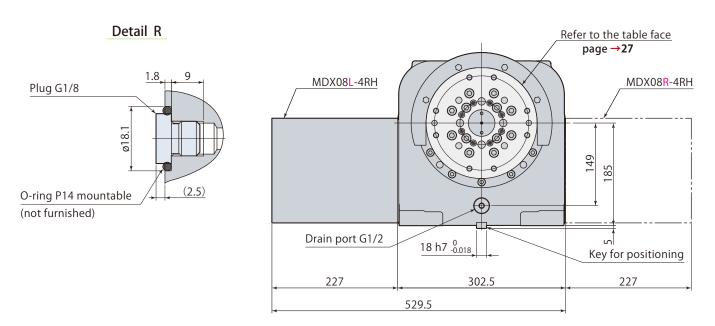


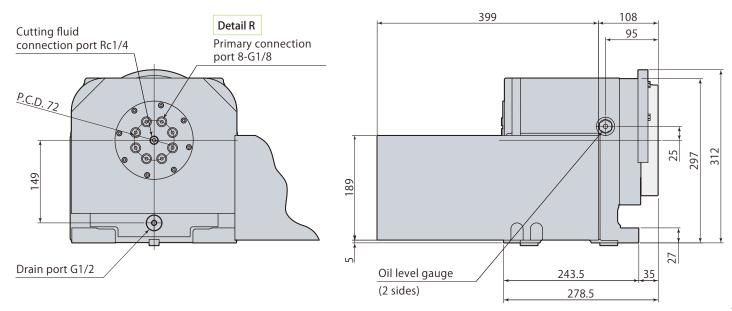


Left: MDX08L-4 Right: MDX08R-4

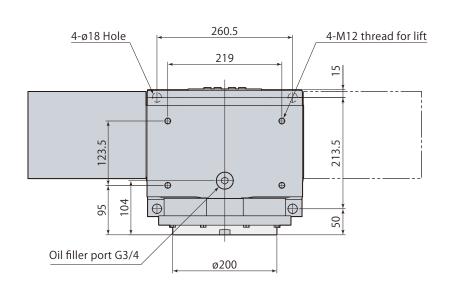


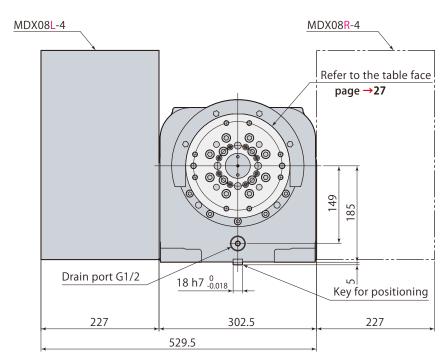


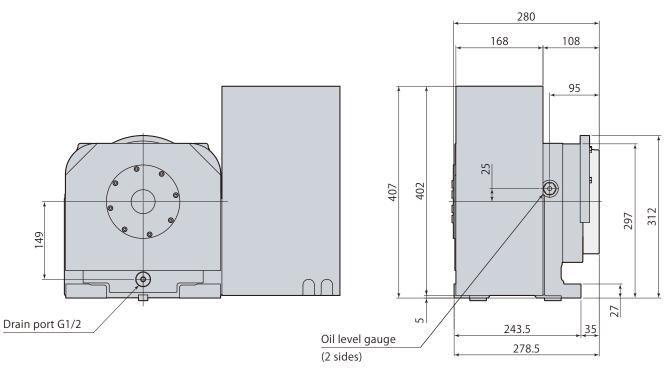



Left: MDX08L-4H Right: MDX08R-4H

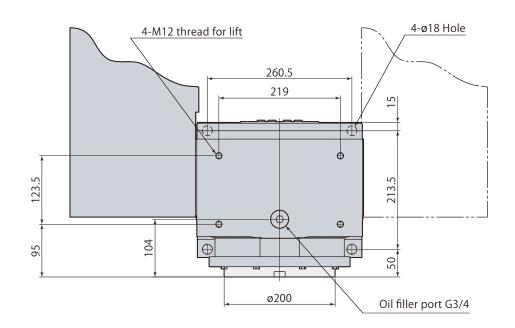


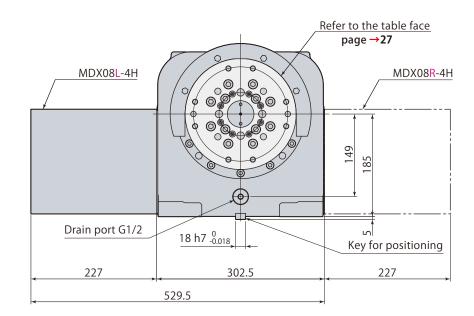


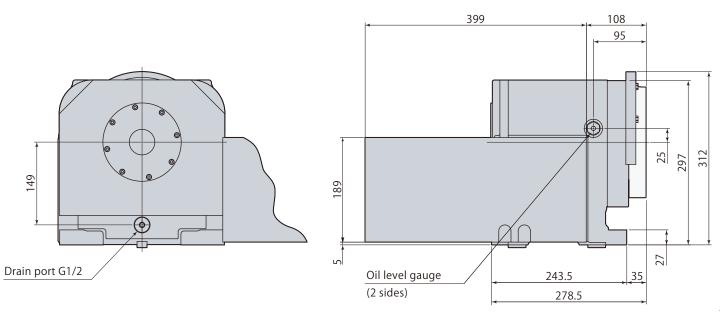


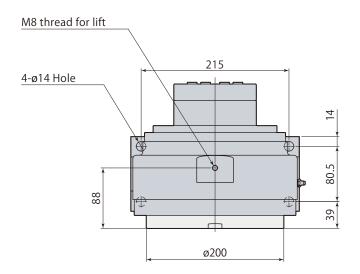


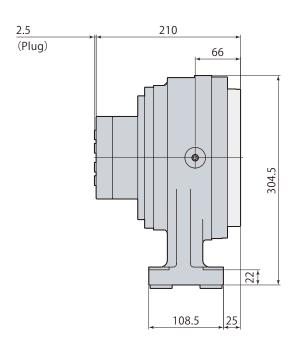


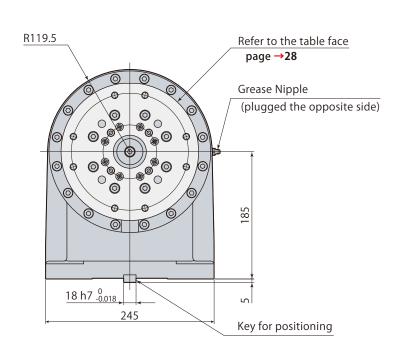


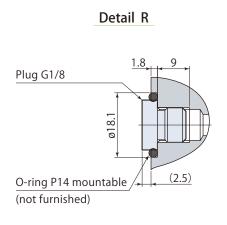


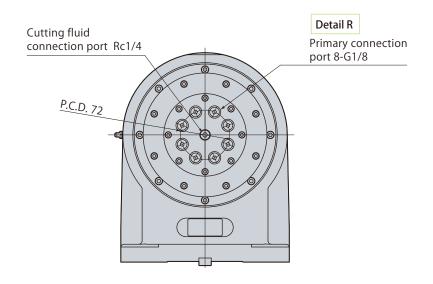

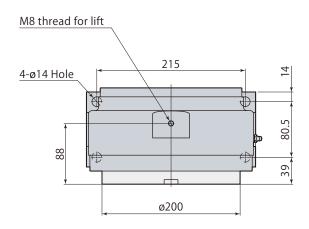

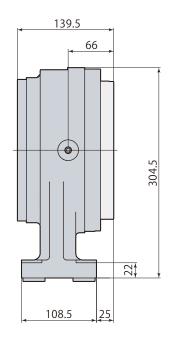


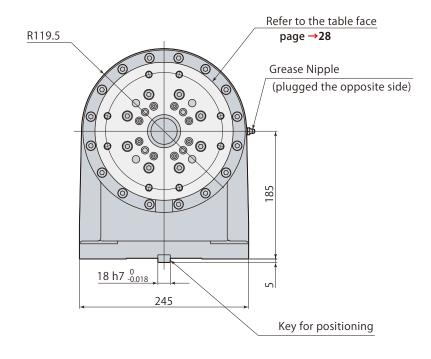


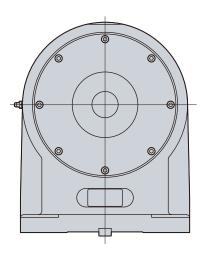


#### 90° Index table face

#### MDX08 (common)

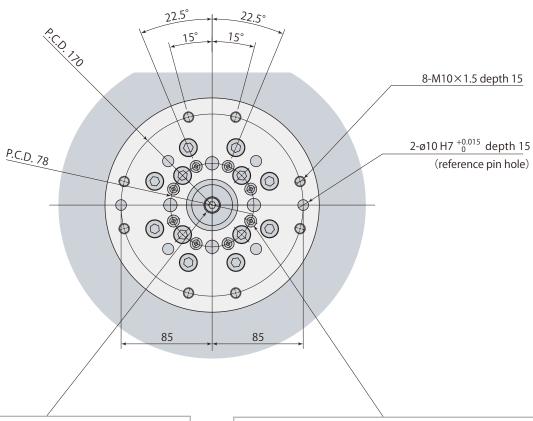

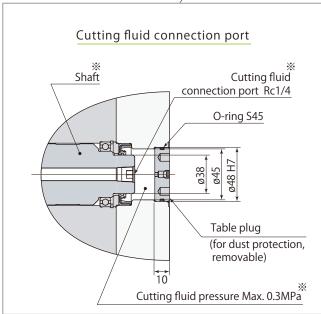


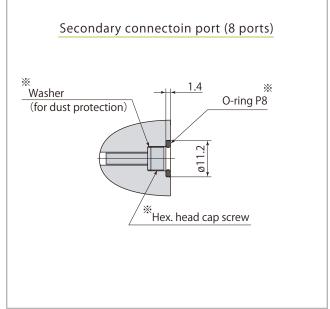



※: Only built-in rotary joint

#### Support table face

#### MDS08 (common)

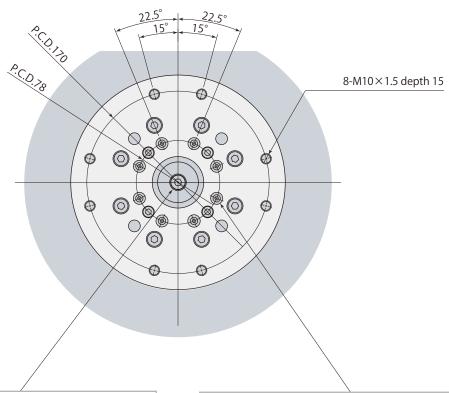


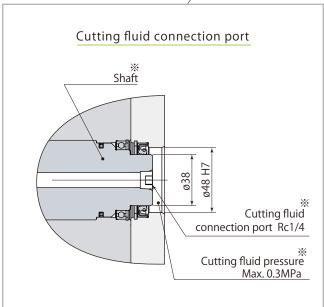

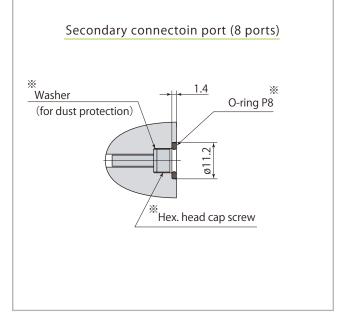


**※**: Only built-in rotary joint

# A jig integrating with expansion clamps for mass-produced parts.

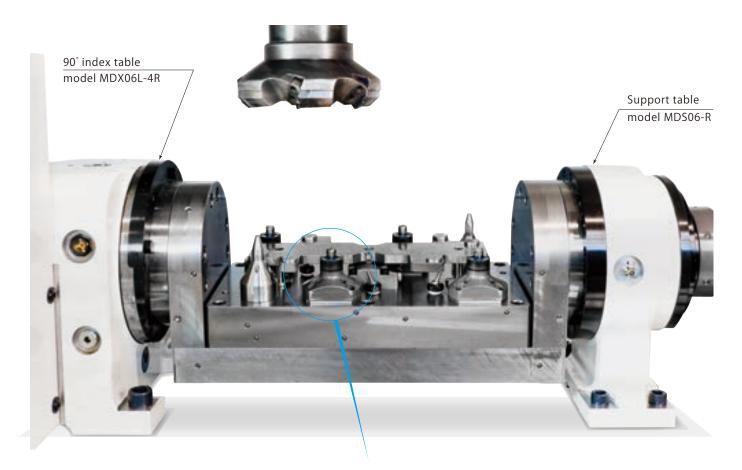


**Expansion clamp** 




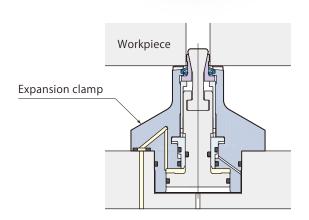


# 4 sides machining in a small space

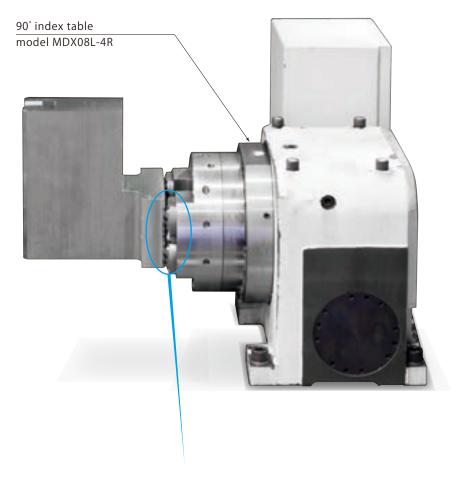


Expansion clamp

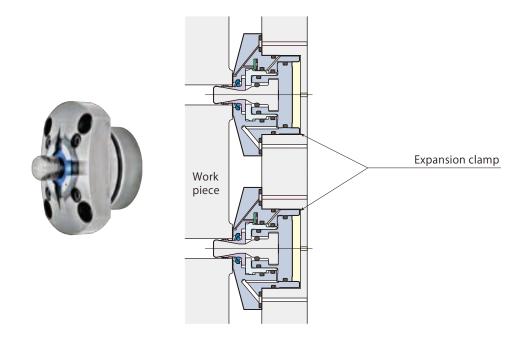


#### 5-side machining jig integrating with Pal coupling

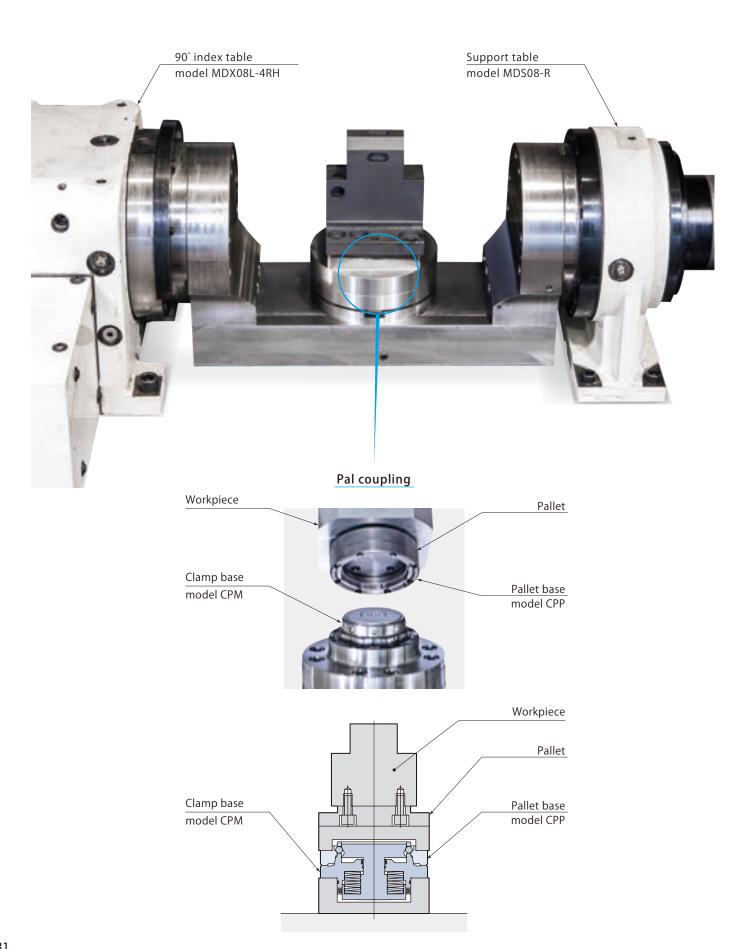


#### 2nd machining after turning

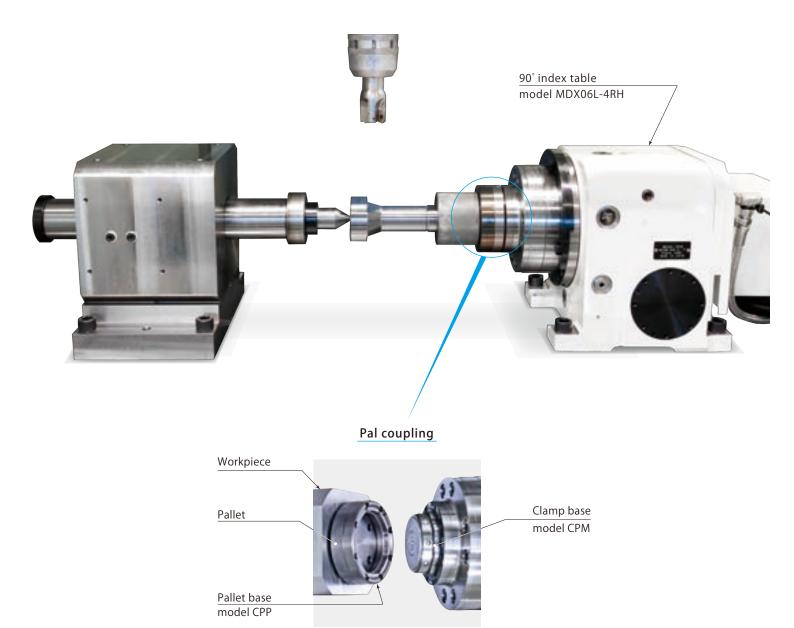


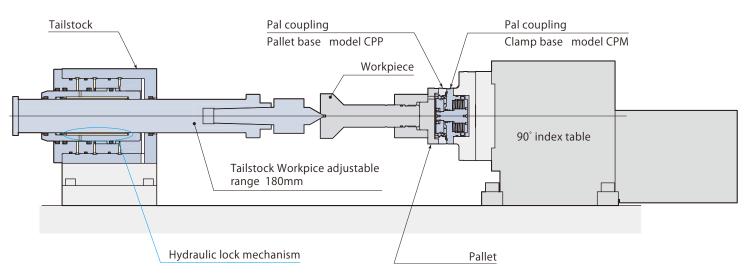


# A jig for variety of workpice integrating with a hydraulic centering vise

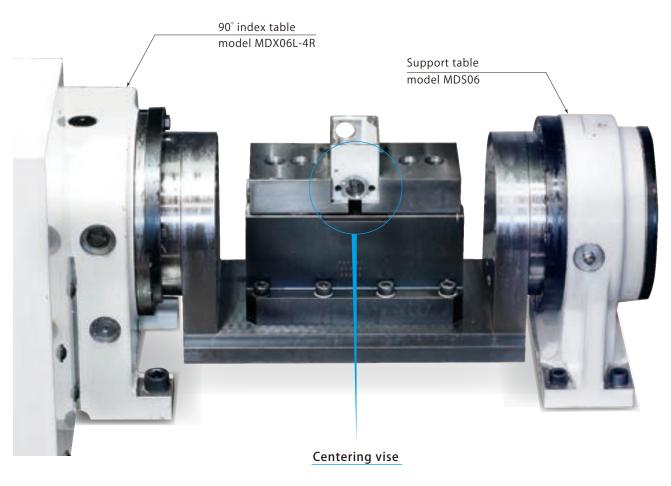




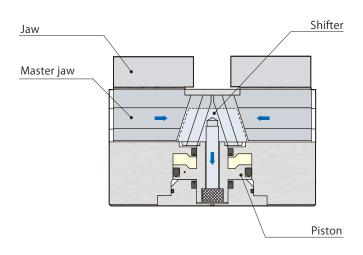

# Multi-face machining for a long workpiece

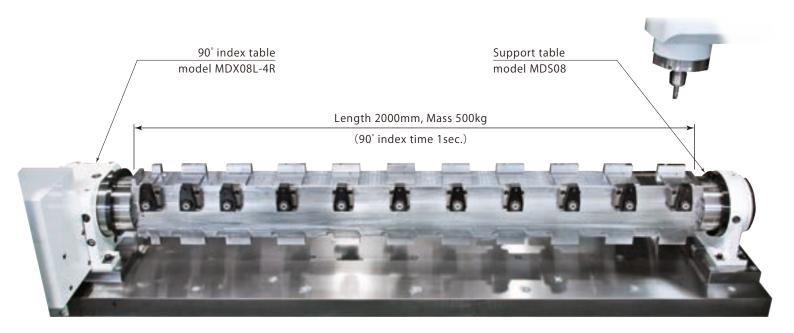

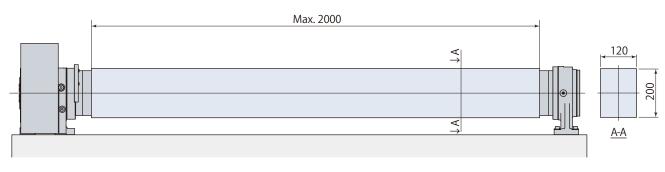

mm

# **Pascal**

Itami, Hyogo, Japan 664-8502 TEL. 072-777-3333 FAX. 072-777-3520

